

JMS578固件分位更新 (适用3139U3、6139U3、7688U3、MD35U3)

更新说明：

本次更新主要解决使用大于2TB容量（有数据资料）的硬盘不能正常识别，显示为GPT保护分区 或 需要重新初始化硬盘。


JMS578_Firmware Update_ (For 3139U3、6139U3、7688U3、MD35U3)

Release Notes,

This update is mainly used to solve the use of greater than 2TB capacity (with data) of the hard disk can not be properly identified, shown as GPT protected partition or need to re-initialize the hard disk.


步骤一：打开“Tool”文件夹，运行“JMMassProd2_v1_16_14_25.exe”程序。

Step 1, Open the "Tool" folder and run the " JMMassProd2_v1_16_14_25.exe " program.

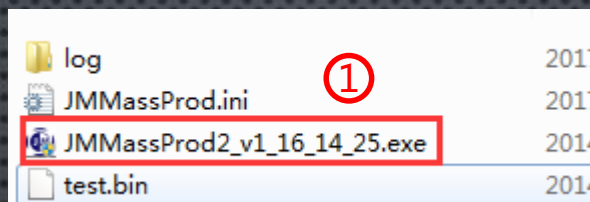

步骤二：勾选上“RD Version”。

Step 2, Check the "RD Version"

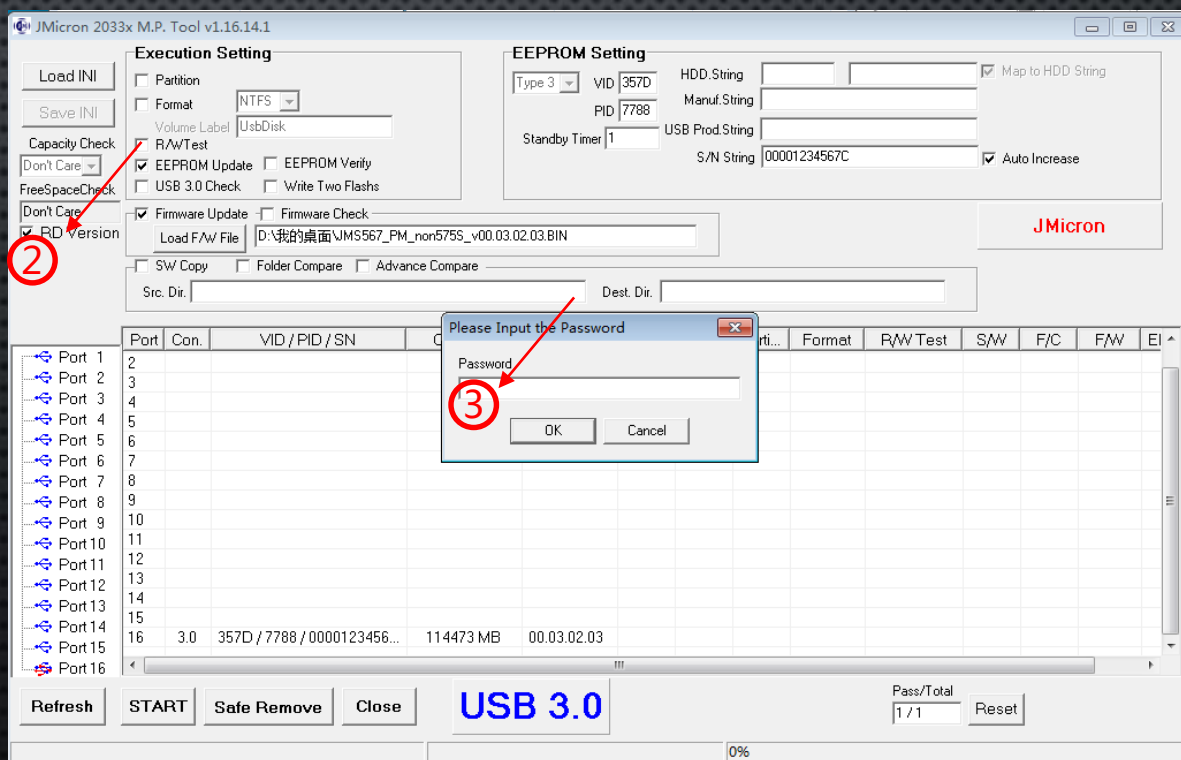


步骤三：输入密码：jmicron

Step 3, Enter the password: jmicron

步骤四：点击 “Load F/W File” 加载固件。

Step 4, Click "Load F / W File" to load the firmware file.

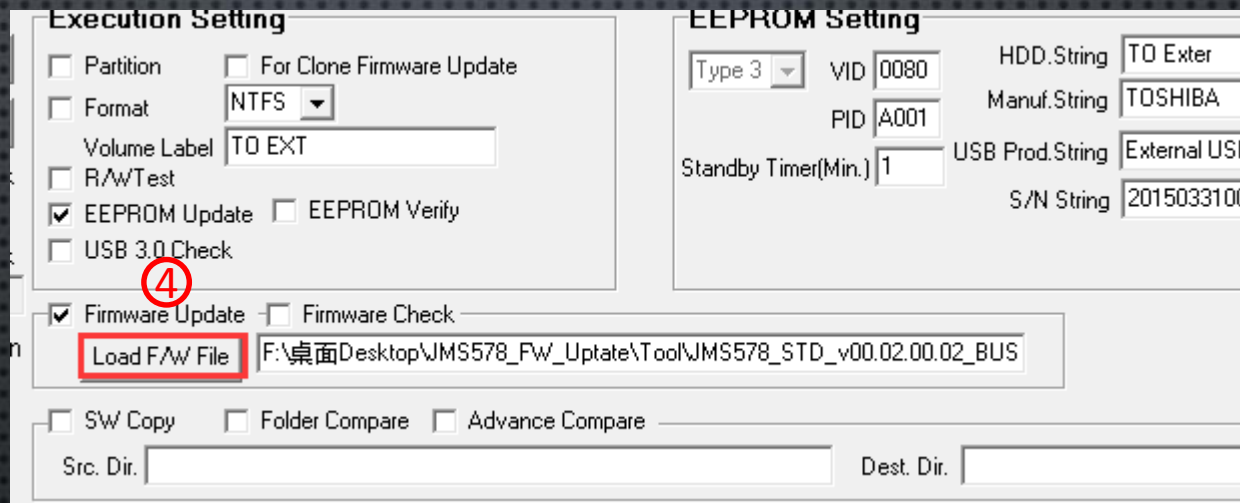


步骤五：打开 “Firmware” 文件夹，选定文件 “ JMS578_STD_v00.02.00.02_BUSPower ” ，点击 “打开” 。

Step 5, Open the "Firmware" folder, select " JMS578_STD_v00.02.00.02_BUSPower " file.



步骤六：点击 “START” 开始刷新固件，提示PASS，表示刷新固件成功。

Step 6, Click “START” to start refreshing the firmware, suggesting that PASS, that refresh the firmware success.

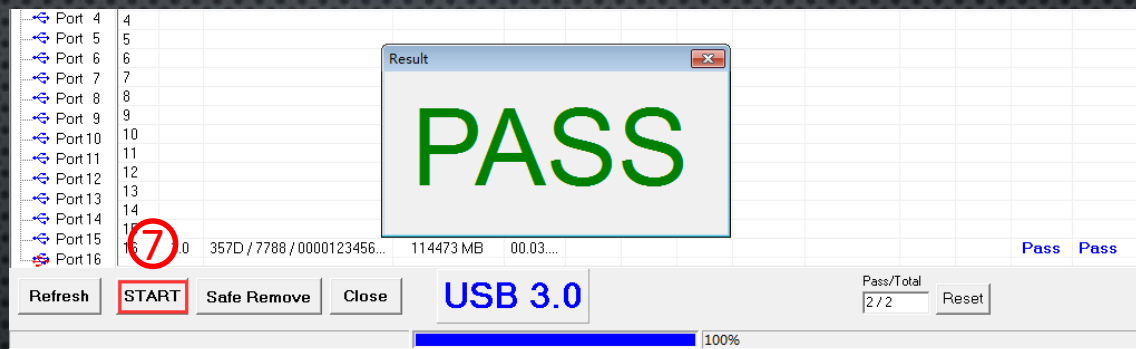

步骤七：重启设备生效！

Step 7, Reboot the device to take effect !

Any comments?
Just contact us
Thanks

ORICO Technologies Co.,Ltd

Email: supports@orico.com.cn

<http://www.orico.com.cn>

<http://www.orico.cc>